

PURPOSE / USE - The Service Notice is used by Leitner-Poma Canada Inc. to convey useful new information to the users of its products. This information is advisory in nature and the Service Notice does not mandate action by the user.

LEITNER-POMA SERVICE NOTICE

NOTICE NO: SN-0701-01-R0

DATE: January 4, 2007

AFFECTED COMPONENTS: BM Manufactured Chairs

BY: Murray Frankcom, P.Eng.

SUBJECT: Armrest Bracket Holes

TO: Owners and Operators

SUMMARY

It has been very recently discovered that some BM supplied chairs have had additional hole(s) drilled in the armrest attachment brackets in an apparent attempt to resolve initial assembly fit-up problems. Also, some of the holes (original or additional) have been found to be drilled too close to the edge of the material. For this particular type of application, the distance from the edge of a hole to the edge of the material should not be less than 2 X the material thickness.

RECOMMENDED ACTIONS

1. **CONDUCT 100% VISUAL INSPECTION OF ALL CHAIRS:** This step should be taken to ensure that all potential trouble areas are identified. Please refer to the photos below for guidance.




**ARMREST BRACKET
(ASSEMBLED)**




**ARMREST ATTACHMENT BRACKET
(DIS-ASSEMBLED)**



**EXAMPLE OF ADDITIONAL HOLE
TOO CLOSE TO EDGE (TOP VIEW)**

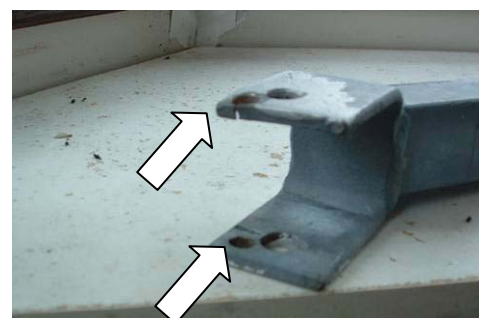

**EXAMPLE OF ADDITIONAL HOLE(S)
(ISO VIEW)**

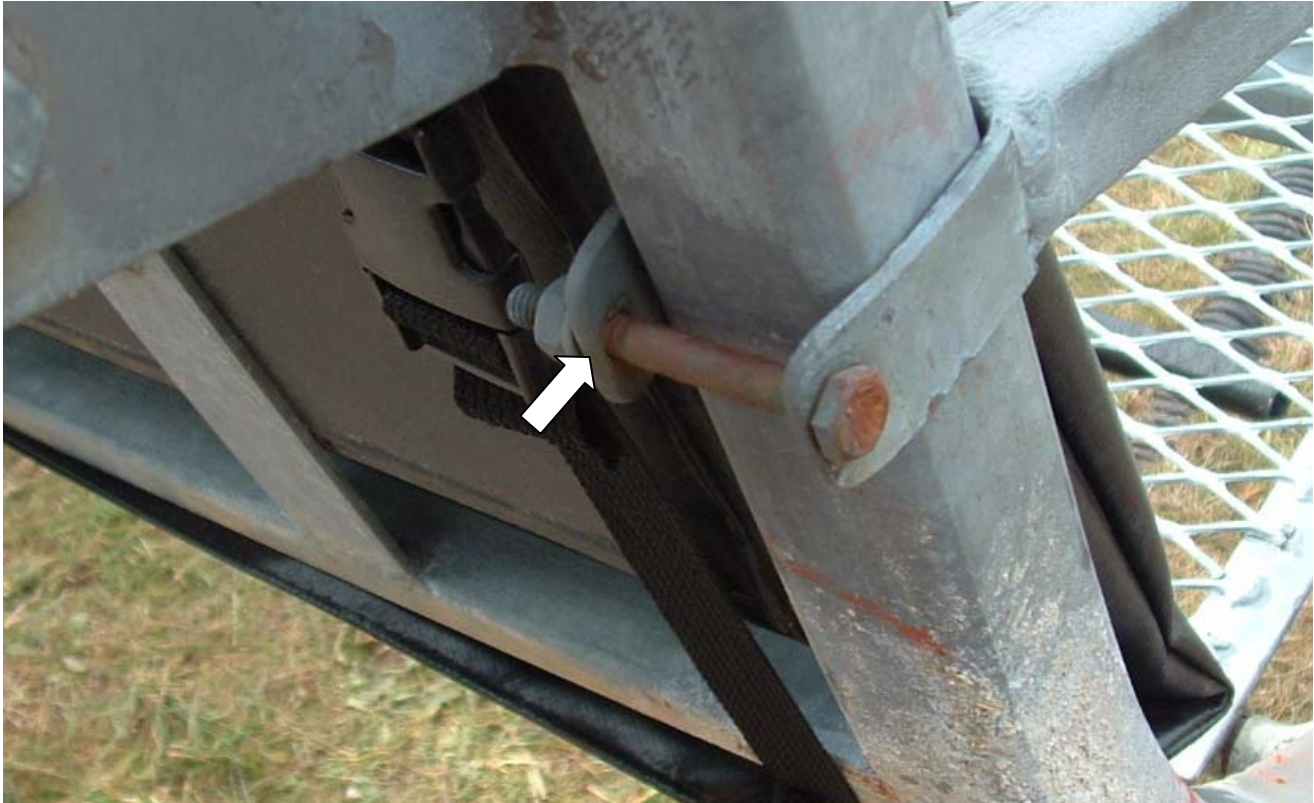

EXAMPLE OF HOLE TOO CLOSE TO EDGE

2. **REPORT ANY OCCURENCES:** If any extra holes are found, or if a holes edge is found to be closer than 2 X the material thickness from the material edge, please contact Leitner-Poma Canada by fax and provide a summary report indicating the installation number of the lift and the quantity of carriers that have been affected. A repair procedure is being developed and will be distributed accordingly.
3. **CONFIRM THE RECEIPT OF THIS NOTICE:** (mandatory) Please complete, sign, and fax back the following page as acknowledgement of receipt to:

Leitner-Poma Canada at 705.722.3170
Attn: Murray Frankcom



SERVICE NOTICE RECEIPT CONFIRMATION FORM

TO: Leitner Poma Canada
FAX: 705.722.3170
ATTN: Murray Frankcom

NOTICE#: SN-0701-01-R0
AFFECTING: BM Manufactured Chairs
SUBJECT: Armrest Bracket Holes

Requested Information

SKI AREA NAME:		INSTALLATION#:	
PRINT YOUR NAME:		TITLE:	
SIGNATURE:		DATE:	
ITEMS FOUND:	<input type="checkbox"/> Additional Holes <input type="checkbox"/> Holes Too Close to Edge <input type="checkbox"/> No Problems		

COMMENTS: